


# Product Information


## Fiat Punto: Front Coil Spring: RH2627

The front of a Fiat Punto uses a side load spring, also called a banana spring. The spring is curved when uncompressed, but when fitted correctly to the shock absorber, it straightens. It's essential that the top plate and strut mount are fitted in the correct position.


June 2015

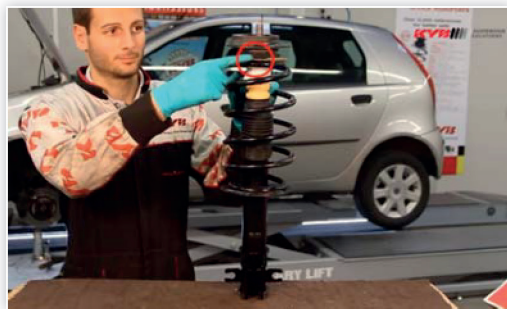

If the top plate is not positioned correctly, the spring will bend. This will make a noise and may even touch the inner wing.

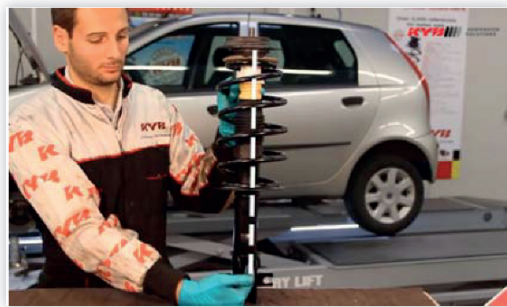

The top plate slot must be in line with the lower knuckle bracket of the shock absorber.

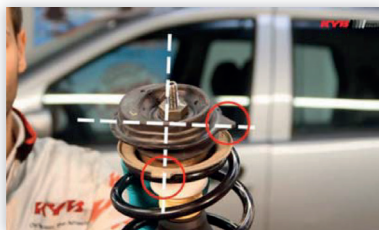

The strut mount is on the bearing which can rotate to have the strut assembly fitting to the car body correctly. The strut mount must be positioned at a 90 degree angle from the top plate slot.

It's important that the strut mount is facing in the right direction, as per these photos.

KYB has a fitting video to help explain the correct alignment and fitment - <http://tinyurl.com/KYBPunto>